



# Service Bulletin

## PRELIMINARY INFORMATION

**Subject:** P16D0 Oil Leak Inspect Oil Galley Plugs In Head

**Models:** 2014-2015 Chevrolet Impala  
2014-2015 Chevrolet Malibu  
Equipped with 2.5L RPO LKW

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

### Condition/Concern


After cylinder head replacement, the head may have an external oil leak and/or set P16D0

### Recommendation/Instructions

If the head has an external oil leak, verify oil galley plugs #5 and #6 (see illustration below) have been installed.

If code P16D0 sets, verify oil galley plug #10 (see illustration below) has been installed. This oil galley plug is located in the head, behind the timing cover and would have an engine oil leak that is internal of the engine.

Oil galley plugs #9 (see illustration below) should already come installed in the new head.

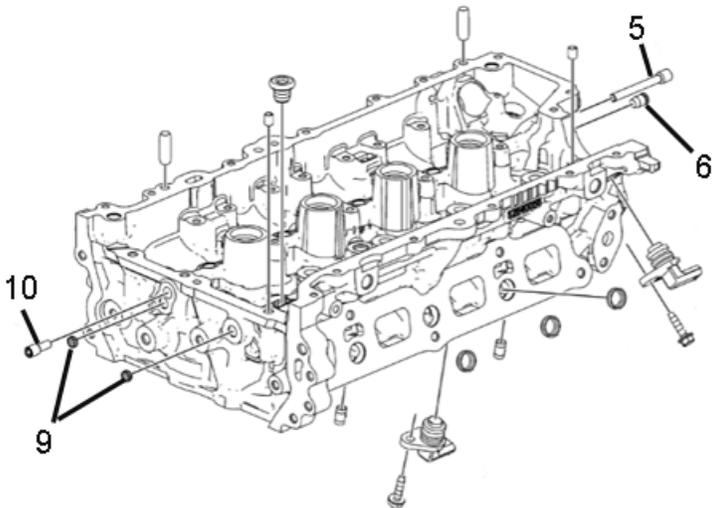

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION